


Pasos imperiales


MXL - XL - L - H - XH - XXH

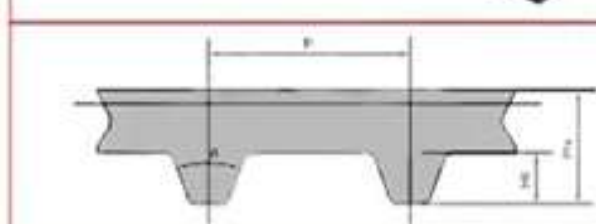

Tipo	P	H ₁	H ₂	Angulo
MXL	2.032	0.51	1.14	40°
XL	5.080	1.27	2.30	50°
L	9.525	1.91	3.60	40°
H	12.70	2.29	4.30	40°
XH	22.225	6.35	11.20	40°
XXH	31.750	9.53	15.70	40°

Pasos métricos HTD


HTD 2M - 3M - 5M - 8M - 14M - 20M

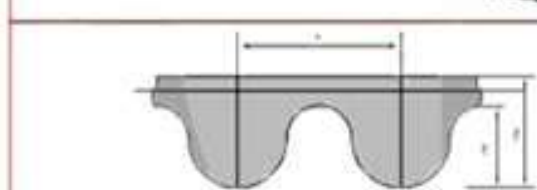

Tipo	P	H ₁	H ₂
HTD 2M	2	0.75	1.36
HTD 3M	3	1.17	2.4
HTD 5M	5	2.06	3.8
HTD 8M	8	3.36	6.0
HTD 14M	14	6.02	10.0
HTD 20M	20	8.4	13.20

Pasos métricos STS


STS S2M - S3M - S4.5 - S5M - S8M - S14M

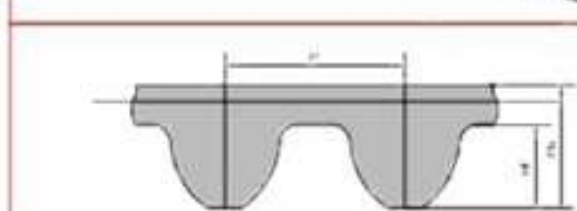

Tipo	P	H ₁	H ₂
S 2M	2	0.76	1.36
S 3M	3	1.14	2.20
S 4.5M	4.5	1.71	2.81
S 5M	5	1.91	3.4
S 8M	8	3.05	5.3
S 14M	14	5.3	10.2

Pasos métricos RPP


RPP 2M - RPP 3M - RPP 5M - RPP 8M - RPP 14M

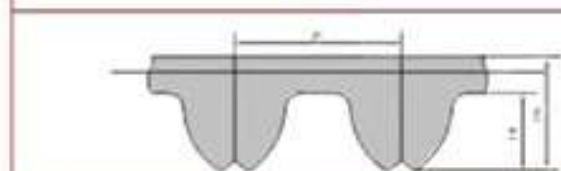

Tipo	P	H ₁	H ₂
RPP 2M	2	0.76	1.36
RPP 3M	3	1.15	1.9
RPP 5M	5	1.95	3.5
RPP 8M	8	3.2	5.5
RPP 14M	14	6	10

Pasos métricos T


T2.5 - T5 - T10 - T20

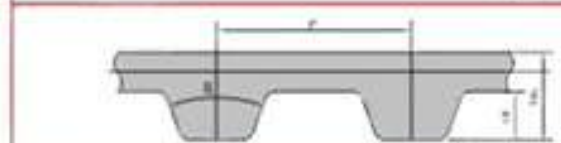

Tipo	P	H ₁	H ₂	Angulo
T2.5	2.5	0.7	1.3	40°
T5	5	1.2	2.2	40°
T10	10	2.5	4.5	40°
T20	20	5	8	40°

Pasos métricos AT

AT5 - AT10 - AT20

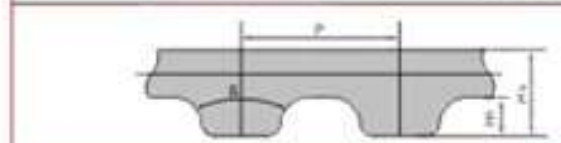


Tipo	P	H ₁	H ₂	Angulo
AT5	5	1.2	2.7	50°
AT10	10	2.5	5	50°
AT20	20	5	8	50°

Ejemplos de orden


Pasos Imperiales

140 XL 050

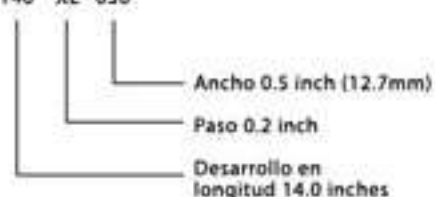


Paso métrico T

32 T10 1210

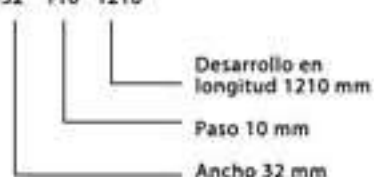

Paso métrico STS

300 S8M 1400

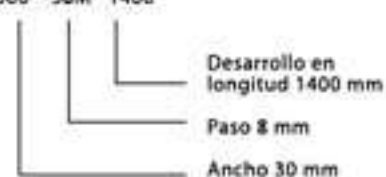

Nota: También disponible en Poliuretano con refuerzo en acero / Kevlar TM